

REPLACEMENT ACCUMULATOR ADVISORY



PRODUCT 50402-1SP

BACKGROUND

The incorrect but identical-in-appearance 0.32 L accumulator was ordered from our vendor and supplied under Part No. 50402-1SP. While the accumulator was sold and distributed from April 17, 2024, to January 22, 2025, it will meet specifications for the Seakeeper models listed below, previously requiring part number 50273-1SP. However, it will not meet the specifications for the Seakeeper 40 model.

MODEL	SERIAL RANGE
Seakeeper 2	All serial nos.
Seakeeper 16/12HD (EM)	16/12HD-0504 thru 16/12HD-193-0916
Seakeeper 26/20HD	All serial nos.
Seakeeper 35	All serial nos.
M-21000, 21000A, and 26000	All serial nos.

To distinguish between the 50273-1SP and the 50402-1SP accumulator, one can use the stamped vendor part numbers on the accumulator sides beneath the weld bead. The 50273 part number reads 2208733, and the 50402 part number reads 2217589.

If an accumulator with a vendor part number of 2207833 is in your inventory, it is Seakeeper part number 50273-1SP and should **not** be used on Seakeeper 40 models. However, it may be used on the other models listed in the table above.

If a dealership has serviced a Seakeeper 40 during this period with an accumulator replacement, contact Seakeeper Product Support Team with details of the service (Serial number, case number, etc.) at support@seakeeper.com.

NOTE: The **50402-1.1SP** will be the correct item part number on all future orders.